

ASSEMBLY INSTRUCTION

NP*XX Series | Professional 1/4" Plugs

CABLE & BOOT ASSEMBLY





A Slide the boot onto the cable.

PREPARE CABLE


Wire size: max. 1.0 mm² / 18 AWG Cable O.D.:

Prepare cable as shown.

4.0 - 7.0 mm [0.16-0.28"]

- **B** NP2XX 4 <u>mm</u> Tip [0.16"] Sleeve 6 mm [0.24"] 16 mm [0.63"] **(C)** NP3XX 8 mm [0.35"] 4 <u>mm</u> [0.16"] Tip Ring Sleeve
- (A) Cable size information.
- **B** 2 pole plug cable preparation.
- © 3 pole plug cable preparation.

SOLDER CABLE

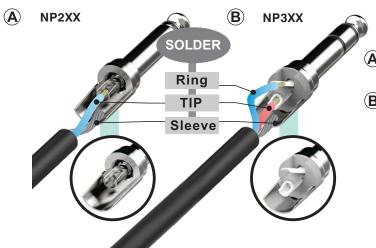

Solder the wire ends.

2 pole with Tip & Sleeve

B 3 pole with Ring, Tip & Sleeve

BDA 688 V2 Page 1



4 INSERT & HOUSING ASSEMBLY



(A) Position the chuck onto the cable (1) and align chuck with plugfinger (2).

Attention:

If using a cable with O.D. > 5.50 mm [0.216"] break away this part of the chuck.

- B Slide the housing onto the plugfinger with the chuck.
- © Finish the installation (1) by tighten the bushing (2) onto the connector.





More Information on the website

https://www.neutrik.com/en/neutrik/products/plugs-jacks/plugs/professional-1-4-plugs





Draft. Nr.: BDA 713 V2 Update: 2025-05-21

Neutrik AG | LI-9494 Schaan

www.neutrik.com

